

Calibration Instructions R323 Indicator



To Zero the Display

- ⊕ Press f and POWER KEY at the same time holding both for 2 seconds
The Display will beep twice and then show **SETUP**
- ⊕ The display will then show **bUiLd**
- ⊕ Press ZERO Display will show **OPTiON**
- ⊕ Press ZERO again Display will show **CAL**
- ⊕ Press TARE Display will show **ZERo**
- ⊕ Press GROSS/NET Display will show weight approximately **0.000**
- ⊕ Press Print Display will show **Z. in P**, when complete will show **0.000** exactly
- ⊕ Press the Zero button eight times until the display shows **-END-**
- ⊕ Press f Display will return to normal weighing

Load vehicle, weigh the vehicle at a weighbridge obtaining the NETT Payload

- ⊕ Press f and POWER KEY at the same time holding both for 2 seconds
The Display will beep twice and then show **bUiLd**
- ⊕ Press ZERO Display will show **OPTiON**
- ⊕ Press ZERO again Display will show **CAL**
- ⊕ Press TARE twice Display will show **SPAN**
- ⊕ Press GROSS/NET Display will show a weight, if this weight needs adjusting:
The display will show a **flashing** digit
- ⊕ Press GROSS/NET again To move the flashing along the line of digits
- ⊕ Press GROSS/NET again To adjust the flashing digit between **1 and 9**, when the correct digit is shown
- ⊕ Press GROSS/NET again To move the flashing digit across, repeat the above step until the correct weight is shown on the display. When the correct weight is shown
- ⊕ Press f Display will show **S. in P** then flash with the correct weight
- ⊕ Press the Zero button eight times until the display shows **-END-**
- ⊕ Press f Display will return to standard weighing mode