

QUICK SETUP GUIDE VWS N320 INDICATOR



This Setup Guide requires the Tipper Body to be raised totally clear of the chassis usually 6 – 8” is enough for this purpose

TO SET ZERO (with Body Empty)

- ⊕ Press and hold POWER & ZERO keys, the indicator displays 'DRIVER', 'SET UP' & 'ZERO'
- ⊕ Press TARE key to show the current Zero offset
- ⊕ Press f key to start the zeroing process, the indicator will display 'Z in P' (Zero in Progress) and then displays '0 kg'
- ⊕ When '0 kg' is displayed, press ZERO key until the indicator displays 'SAVE'
- ⊕ Press f key to exit set up, 'SAVING' will flash up and the indicator will now display '0'

TO SET THE TARE WEIGHT OF THE VEHICLE

- ⊕ Press and hold POWER & ZERO keys, the indicator displays 'DRIVER', 'SET UP' & 'ZERO'
- ⊕ Press the ZERO key until 'TARE' is displayed
- ⊕ Press TARE key to display the current setting
- ⊕ Use GROSS/NET key to move along the digits until they flash press PRINT key to change the flashing digits to enter in the tare weight of the vehicle i.e. 012500 kg
- ⊕ Press ZERO key until the display shows [-SAVE-], and then
- ⊕ Press f key to exit set up, 'SAVING' will display and the 'TARE' weight should be displayed i.e. 12500 kg

TO SET SPAN (with body loaded to a known weight)

- ⊕ Press and hold POWER & ZERO keys, the indicator displays 'DRIVER', 'SET UP' & 'ZERO'
- ⊕ Press the ZERO key to display LOAD
- ⊕ Press TARE & the indicator will display the previous calibration weight
- ⊕ Press the GROSS/NET key to display the current weight reading
- ⊕ Use the GROSS/NET key to move along the digits until they flash and the PRINT key to change the flashing digits to enter your new calibration weight which is your payload weight
- ⊕ When correct payload weight is displayed (i.e. 019400 kg) press f key to start the calibration process. The indicator will display 'S in P' (Span in Progress), the live weight, i.e. 019400 kg will display
- ⊕ Press 'ZERO' key until the indicator displays 'SAVE', then press f key to exit set up, 'SAVING' will be displayed and the 'NET' weight displayed, i.e. 19400 kg

VWS N320 INDICATOR ALARM SETTING GUIDE



To Set The Alarm

- ⊕ Press and hold POWER & ZERO keys, the indicator displays 'DRIVER', 'SET UP' & 'ZERO'
- ⊕ Press ZERO until the indicator displays 'ALRM 1'
- ⊕ Press TARE key to show the current setting
- ⊕ Press GROSS/NET key to move along the digits until they flash and press PRINT key to change the flashing digits to enter in the point at which the Alarm will sound i.e. 031900 kg
- ⊕ Press ZERO key until the display shows '-SAVE-', and then press f key to exit set up, 'SAVING' will display and the current weight should be shown on the display
- ⊕ The alarm will sound at 31,900 kg. Press f to mute